



Technical Circular

No.: 036/2022

Date: 26th April 2022

Subject: USCG Marine Safety Alert 04-22 Reg. Handhold in Gateway Embarkation Arrangements.

1. The United States Coast Guard (USCG) while investigating a casualty involving a fall from Pilot Ladder noted that the handholds in the gate arrangement aboard the vessel terminated without being rigidly secured to the vessel's structure as against the SOLAS requirement requiring that each handhold in a gateway arrangement should be rigidly secured to the ship's structure at or near its base.
2. Apparently the above modification was effected to accommodate the length of the pilot ladder spreader during deployment and retrieval of the pilot ladder. The modification made it possible to retrieve the pilot ladder without having to lift the spreader up and over the vessel's railings.
3. In view of above, USCG has issued Marine Safety Alert 04-22 addressing the importance of verifying the correct arrangement of handholds in embarkation gate arrangements aboard merchant vessels and has provided following recommendations:
 - a. Ensure familiarity with applicable requirements pertaining to handholds in gateway embarkation arrangements aboard merchant vessels.
 - b. Visually examine handholds in gateway embarkation arrangements for gaps, specifically at the lower terminations.
 - c. Initiate rectification and issue outstanding conditions to meet regulatory intent for any non- conformities discovered.
4. Ship Owners/Operators and Masters are advised to be guided by above and ensure compliance.

Enclosure:

1. USCG Marine Safety Alert 04-22.



. This Technical Circular and the material contained in it is provided only for the purpose of supplying current information to the reader and not as an advice to be relied upon by any person.

. While we have taken utmost care to be as factual as possible, readers/ users are advised to verify the exact text and content of the Regulation from the original source/ issuing Authority.

Whilst the utmost care has been taken in the compilation of the Technical Information, neither Indian Register of Shipping, its affiliates and subsidiaries if any, nor any of its directors, officers, employees or agents assume any responsibility and shall not be liable to any person for any loss, damage or expense caused in any manner whatsoever by reliance on the information in this document.



UNITED STATES COAST GUARD
U.S. Department of Homeland Security

MARINE SAFETY ALERT

Inspections and Compliance Directorate

April 19, 2022
Washington, DC

Safety Alert 04-22

VERIFY GATEWAY HANDHOLD ARRANGEMENTS **Incorrect Terminations Can Lead to Marine Casualties**

This Safety Alert addresses the importance of verifying the correct arrangement of handholds in embarkation gate arrangements aboard merchant vessels.

The Coast Guard is currently investigating a casualty involving a fall from a pilot ladder where the handholds in the gate arrangement aboard the vessel terminated without being rigidly secured to the vessel's structure. This termination left a gap in the handholds at the transition point at the head of the pilot ladder, where an embarking person might reach to pull themselves onto the vessel (Figure 1).



Figure 1: Handholds that terminate above the vessel structure.



Figure 2: Gap in handholds appear to accommodate spreader.

The Coast Guard observed that the abrupt termination of the handholds above the vessel structure appeared to be a modification that was completed to accommodate the length of the pilot ladder spreader during deployment and retrieval of the pilot ladder. The modification made it possible to retrieve the pilot ladder without having to lift the spreader up and over the vessel's railings (Figure 2).

SOLAS 2004 (Consolidated) is clarified by IMO Resolution A.1045 (27) to indicate that each handhold in a gateway arrangement should be rigidly secured to the ship's structure at or near its base (Figure 3).



Figure 3: Handholds rigidly secured to the vessel structure at their base.

The Coast Guard **strongly recommends** that flag state administrations, classification societies, port state control inspectors, and shipboard personnel:

- Ensure familiarity with applicable requirements pertaining to handholds in gateway embarkation arrangements aboard merchant vessels.
- Visually examine handholds in gateway embarkation arrangements for gaps, specifically at the lower terminations.
- Initiate rectification and issue outstanding conditions to meet regulatory intent for any non-conformities discovered.

The International Organization for Standardization (ISO) recently published a series of standards aimed at improving pilot ladder safety. These standards supplement existing IMO recommendations and requirements for pilot ladders. Vessel owners and operators, shipboard personnel, and system designers are highly encouraged to review and comply with these standards.

- ISO 799-1:2019 Ships and marine technology — Pilot ladders — Part 1: Design and specification
- ISO 799-2: 2021 Ships and marine technology — Pilot ladders — Part 2: Maintenance, use, survey, and inspection
- ISO 799-3:2022 Ships and marine technology — Pilot ladders — Part 3: Attachments and associated equipment

This Safety Alert is provided for informational purposes only and does not relieve any domestic or international safety, operational, or material requirements. Developed by the Coast Guard Sector New York Investigations Division, and distributed by the Office of Investigations and Analysis. Please address questions to HQS-SMB-CG-INV@uscg.mil.

Please note other related available information here:

1. International Maritime Organization (IMO) Resolution A. 1045(27) titled, “Pilot Transfer Arrangements”. The link for this document can be found [here](#).
2. USCG Safety Alert 14-18 titled, “Don’t Forget about Gangways and Ladders! Pilot Dies in Gangway Accident” posted on the DCO site [here](#).
3. International Maritime Organization (IMO)/International Maritime Pilots Association’s “Required Boarding Arrangements for Pilot” poster (found on IMPA’s website [here](#) and also enclosed on page 3).

International Maritime Organization (IMO)/International Maritime Pilots Association's
"Required Boarding Arrangements for Pilot" poster

REQUIRED BOARDING ARRANGEMENTS FOR PILOT

In accordance with SOLAS Regulation V/23 & IMO Resolution A.1045(27)

INTERNATIONAL MARITIME PILOTS' ASSOCIATION

H.Q.S. "Wellington" Temple Stairs, Victoria Embankment, London WC2R 2PN Tel: +44 (0)20 7240 3973 Fax: +44 (0)20 7210 3518 Email: office@impahq.org
This document and all IMO Pilot-related documents are available for download at: <http://www.impahq.org>

RIGGING FOR FREEBOARDS OF 9 METRES OR LESS

COMBINATION ARRANGEMENT FOR SHIPS WITH A FREEBOARD OF MORE THAN 9 METRES WHEN NO SIDE DOOR AVAILABLE

PILOT LADDER WINCH REEL

A

B

All pilot ladder winch reels should have a means of prevention from being accidentally operated.
The brake and lock must be operative on manually operated winches.
Power winches must have an operative safety device to lock the winch in position.

PILOT LADDER SAFETY

NO! No shackles, knots or splices

NO! The steps must be equally spaced

NO! The steps must be horizontal and chocks under the steps must be tightly secured

NO! Spreaders must not be lashed between steps

NO! Side ropes must be equally spaced

NO! The steps should not be painted, dirty or slippery

NO! Loops and tripping lines present a tripping hazard and foul the Pilot Launch

PILOT LADDER CLEARANCE

C